


# Accessories

## Strain Relief Plates (For In-The-Field Assembly or Factory-Assembled)

### MCS-MIDI

<b>Strain relief plates for in-the-field assembly Pin spacing 5/5.08 mm</b>  for female connectors with CAGE CLAMP®S (2721, 2231 and 2-conductor 231, 721 Series)	<b>Strain relief plates for in-the-field assembly Pin spacing 7.5/7.62 mm</b>  for female connectors with CAGE CLAMP®S (2721, 2231 and 2-conductor 231, 721 Series)	<b>Strain relief plates, factory-assembled</b>  for female connectors with CAGE CLAMP®S (2721, 2231 and 2-conductor 231, 721 Series)
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------

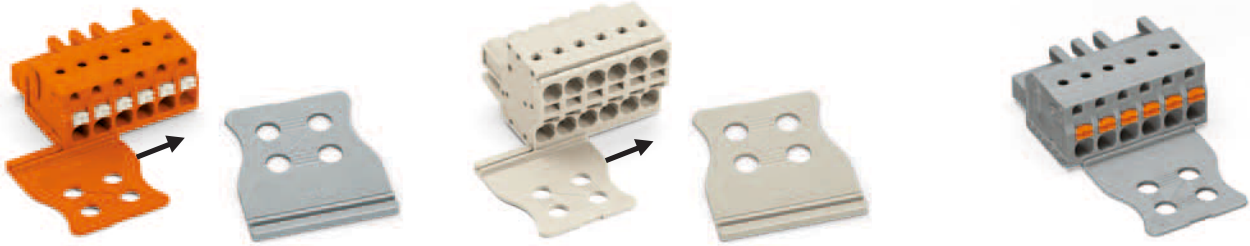

Width	Pole No.	Item No.	Pack. Unit	Width	Pole No.	Item No.	Pack. Unit	Width	Item No. Suffix
<b>Strain relief plate, light gray</b>				<b>Strain relief plate, light gray</b>				<b>Strain relief plate, pre-assembled</b>	
6 mm	2	<b>734-127</b>	100 ( 4 x 25)	6 mm		<b>734-127</b>	100 ( 4 x 25)	6 mm	.../132-000
12.5 mm	3- 4	<b>734-128</b>	100 ( 4 x 25)	12.5 mm	2- 3	<b>734-128</b>	100 ( 4 x 25)	12.5 mm	.../133-000
25 mm	5- 7	<b>734-129</b>	100 ( 4 x 25)	25 mm	4- 6	<b>734-129</b>	100 ( 4 x 25)	25 mm	.../134-000
35 mm	8-11	<b>734-126</b>	100 ( 4 x 25)	35 mm	7- 9	<b>734-126</b>	100 ( 4 x 25)	35 mm	.../135-000
55 mm	12-16	<b>734-426</b>	50 ( 2 x 25)	55 mm	10-12	<b>734-426</b>	50 ( 2 x 25)	55 mm	.../136-000
75 mm	17-24	<b>734-427</b>	50 ( 2 x 25)	75 mm	13-16	<b>734-427</b>	50 ( 2 x 25)	75 mm	.../137-000
<b>Strain relief plate, gray</b>				<b>Strain relief plate, gray</b>				<b>Ordering example:</b> 2-conductor female connector with strain relief plate, 5 mm pin spacing, 8-pole, gray: <b>231-2108/026-000/135-000</b>	
6 mm	2	<b>734-327</b>	100 ( 4 x 25)	6 mm		<b>734-327</b>	100 ( 4 x 25)	<b>Ordering example:</b> Female connector with push-buttons and strain relief plate, 7.5 mm pin spacing, 8-pole, gray: <b>2231-208/026-000/135-000</b>	
12.5 mm	3- 4	<b>734-328</b>	100 ( 4 x 25)	12.5 mm	2- 3	<b>734-328</b>	100 ( 4 x 25)		
25 mm	5- 7	<b>734-329</b>	100 ( 4 x 25)	25 mm	4- 6	<b>734-329</b>	100 ( 4 x 25)		
35 mm	8-11	<b>734-326</b>	100 ( 4 x 25)	35 mm	7- 9	<b>734-326</b>	100 ( 4 x 25)		
55 mm	12-16	<b>734-430</b>	50 ( 2 x 25)	55 mm	10-12	<b>734-430</b>	50 ( 2 x 25)		
75 mm	17-24	<b>734-431</b>	50 ( 2 x 25)	75 mm	13-16	<b>734-431</b>	50 ( 2 x 25)		
<b>Strain relief plate, orange</b>				<b>Strain relief plate, orange</b>				CAGE CLAMP®S-equipped female connectors can be retrofitted with a strain relief plate or pre-assembled with one at the factory. An "item no. suffix", referring to the width of the strain relief plate, is added to the "basic item no." and determines the type of connector (see ordering examples).	
6 mm	2	<b>734-227</b>	100 ( 4 x 25)	6 mm		<b>734-227</b>	100 ( 4 x 25)	The arrangement of the attachments for cable ties allows single conductors or multi-core cables to be secured in different ways	
12.5 mm	3- 4	<b>734-228</b>	100 ( 4 x 25)	12.5 mm	2- 3	<b>734-228</b>	100 ( 4 x 25)		
25 mm	5- 7	<b>734-229</b>	100 ( 4 x 25)	25 mm	4- 6	<b>734-229</b>	100 ( 4 x 25)		
35 mm	8-11	<b>734-226</b>	100 ( 4 x 25)	35 mm	7- 9	<b>734-226</b>	100 ( 4 x 25)		
55 mm	12-16	<b>734-428</b>	50 ( 2 x 25)	55 mm	10-12	<b>734-428</b>	50 ( 2 x 25)		
75 mm	17-24	<b>734-429</b>	50 ( 2 x 25)	75 mm	13-16	<b>734-429</b>	50 ( 2 x 25)		

WAGO does not offer the recommended cable ties and cable binding tools; those are available from suppliers such as Hellermann. The width of the cable ties must correspond to the hole dimensions indicated for the strain relief plates.

